

Volvo Steering Shaft Recall Fact Sheet

Models: 2016 and 2017 Volvo VNL, VNM, and VNX Models with a 2-piece steering shaft.

Build Dates: May 11, 2015 through March 8, 2016.

Type of Steering Shaft: 2-piece, as shown as below. The joint in question is circled in the picture on the left below (Figure 1), with a close-up view shown in the picture on the right (Figure 2).



Figure 1



Figure 2

Interim Fix: Volvo has identified an interim fix which involves drilling an additional hole, and inserting a ¼ inch roll pin. If this solution is applied, the truck is safe to operate and is **NOT** to be placed out-of-service. A picture of the interim solution is shown below (Figure 3):

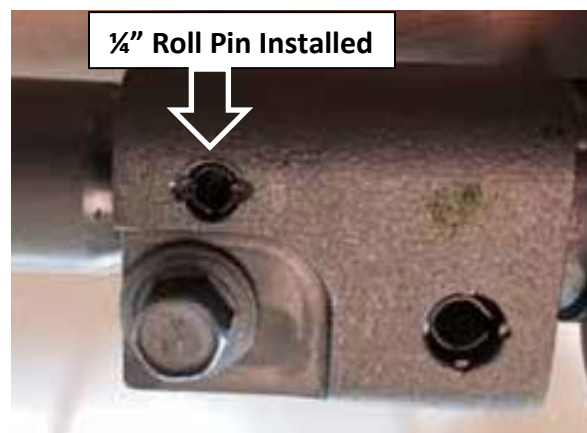


Figure 3

Should the Vehicle be Placed Out-of-Service?

